


Part Numbers: PZNWE12, PZNWE12S

INSTRUCTIONS CM333

© Panduit Corp. 2007

Contents:


- 1 Enclosure
- 1 Aluminum Mounting Plate
- 1 Mounting Template
- 1 Hardware Kit
 - (2) Adhesive Mounting Clips
 - (1) RTV Silicone Sealant Pack
 - (6) # 10-32 x 3/8" Screws
 - (2) # 6-32 x 1/4" Screws
 - (1) UTP or STP MINI-COM TX6 Plus Jack Module
 - (1) 2 Position Surface Mount Box
 - (2) UTP or STP 2' CAT 6 Patch Cord
 - (4) Cable Ties

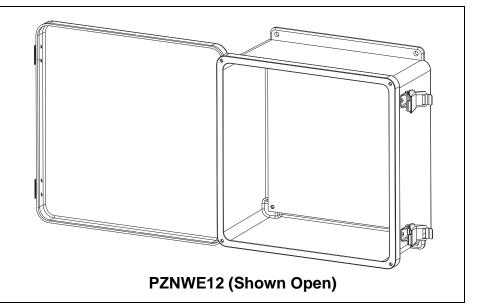


Note: Installer should use the following assembly instructions as a guideline to mount desired Wireless Access Point (WAP), External Antennas, and Powering Device. In the following instructions a *Cisco* Airnet AIR-AP1242AG WAP is shown being installed, however any similar sized WAP with external antennas can be installed in a similar manner.

Assembly Instructions:


1. Use the supplied Mount Template as a guide to locate the hole locations required on the Aluminum Mount Plate. The supplied template reflects the use of a *Cisco* 1200 series wireless access point using POE for power supply.

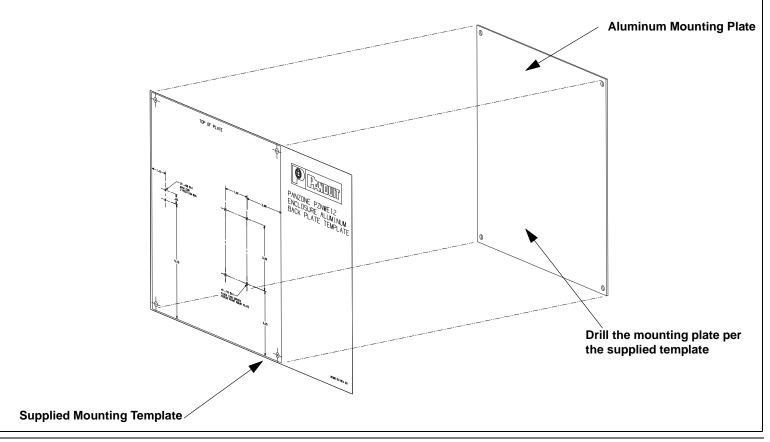

INSTRUCTIONS CM333

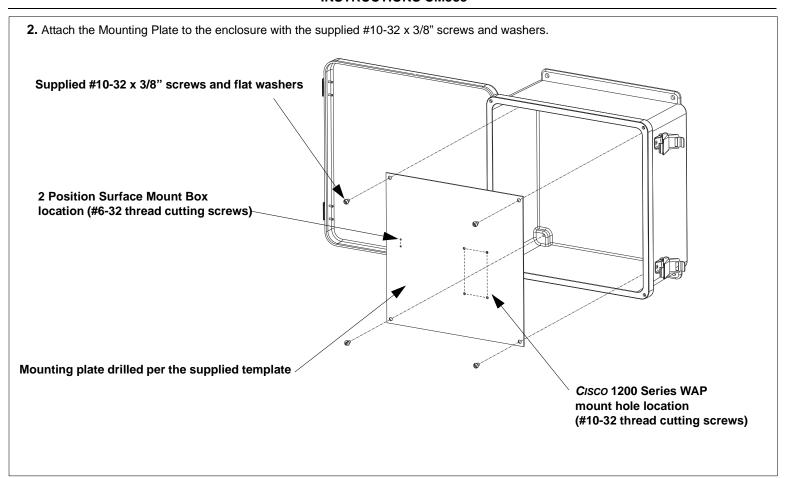

3. For incoming cables install a cord grip such as *PANDUIT* part number **PZNF2** or conduit fitting on the bottom surface of the enclosure in line with the supplied surface mount box. Apply RTV silicone to the surface of the collar of the cord grip to maintain a liquid tight seal.

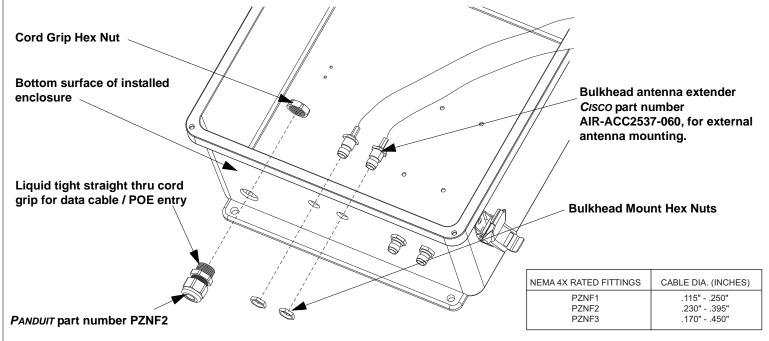

4. Install a bulkhead antenna extender, *Cisco* part number **AIR-ACC2537-060** to the bottom surface of the enclosure as shown. Apply RTV silicone to the surface of the collar of the extender to maintain a liquid tight seal. The desired mount hole diameter is 0.53".

INSTRUCTIONS CM333

5. Fasten the 2 position surface mount box base and the WAP mount plate to the aluminum back plate with supplied thread forming screws


Installed aluminum mounting plate

2 Position surface mount box base

#6-32 flat head thread cutting screws

Cisco WAP mount plate

#10-32 pan head thread cutting screws

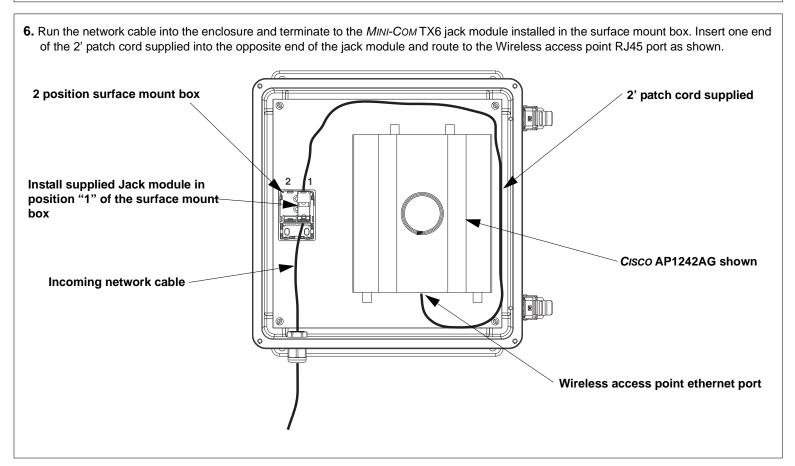

For Technical Support: www.panduit.com/resources/install_maintain.asp

INSTRUCTIONS CM333

7. Attach the required external antennas to the bulkhead fittings installed on the bottom surface of the enclosure. Wrap the excess bulkhead cable slack around the mounted wireless access point. 2' patch cord supplied CISCO AIR-AP1242AG shown 2 Position surface mount box Incoming data/POE cable 5.0 Ghz dipole antenna Cisco 2.4 Ghz dipole antenna Cisco AIR-ANT5135D-R locations shown **AIR-ANT4941 locations shown**

For instuctions in Local Languages and Technical Support:



E-mail: cs@panduit.com Fax: (708)444-6448